











ecorder

Flow

Pre

remp

Analyzer

Leve

Datasheet

Electromagnetic Flow Meter

LDG-SIN

Sinomeasure

Committed to process automation solutions

Tel: 86-13336194863

E-mail: info@sinomeasure.com

www.sino-measure.com



Datasheet

Electromagnetic Flow Meter LDG-SIN

Sinomeasure's electromagnetic flow meter does not contain any moving parts, rotating gears or turbines, or bearings. Instead, it relies on two electrodes to measure the density of the induced magnetic field that results from an electrically conductive fluid, such as water, flowing through a pipe. So there is no susceptibility to bearing wear or other mechanical wear-and-tear issues.

As for the electrodes and the liner used in electromagnetic flow meter, these components can be fabricated from a variety of materials to make the mag meter compatible with virtually various electrically conductive fluid, including aggressive acids.

The only limitation of the electromagnetic flow meter is that the measured fluid media must be electrically conductive (> 5μ S/cm). Non-conductive fluids, such as oil and other petroleum-based fluids, cannot be measured with mag meter technology.

Application

- Sewage treatment
- Printing and dyeing
- Chemical industry
- Environmental protection
- Metallurgy
- Pharmaceutical
- Paper making
- Tap water supply

Features

- 0.5%F.S measuring accuracy
- RS-485 modbus communication, 4-20mA output
- It can measure the flow of fluid in the forward and reverse directions.
- Unaffected by the temperature, pressure, density of the liquid.
- There is no pressure loss.
- Readings that are unaffected by changes in density or viscosity.
- The grounding screws are available by default



Electromagnetic Flowmeter



Principle

The measurement principle of magnetic flowmeters can be described as follows: when the liquid goes through the pipe at the flow rate of v with a diameter D, within which a magnetic flux density of B is created by an exciting coil, the following electromotive E is generated in proportion to flow speed v:

$$E=K\times B\times V\times D$$

Where:

E-Induced electromotive force


K-Meter constant

B—Magnetic induction density

V—Average flow speed in cross-section

of measuring tube

D-Inner diameter of measuring tube

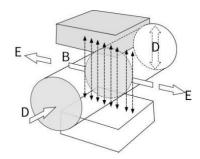

The induced voltage signal is detected by two electrodes and transmitted to the converter via a cable. After a series of analog and digital signal processing, the accumulated flow and instant flow are displayed on the display of the converter.

Accuracy

Reference condition


(1) Medium: water;

(2) Measuring medium temperature: 20°C;

(3) Ambient temperature: 20°C;

(4) Pressure: 0.1MPa;

(5) Recommended installation conditions: straight section >10 DN before the inlet, straight section >5 DN after the outlet

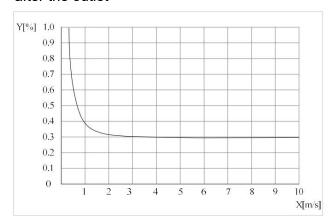


1 X[m/s]: Flow rate

② Y[%]: Actual measured value deviation

Type

Remote type


- Remote type flowmeter signal converter
- ② Remote type electromagnetic flowmeter sensor
- 3 Signal cable
- (4) User manual

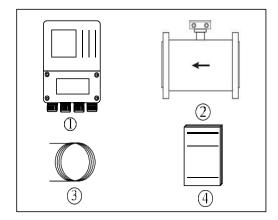

Compact type

Compact type

- ① Compact type electromagnetic flowmeter
- ② User manual

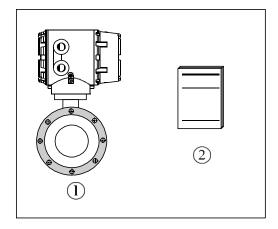

Power supply 85-245 VAC. 50/60 Hz. 22-26 VDC Power consumption Max 15W Insulation resistance ≥20MΩ Signal cable Apply only for remote type Output Current output Function Measurement of volume or mass flow (if the density is constant) Setting Max 20 mA Max 20 mA Min 4 mA Intertion 4 mA Intertion Set up pulse and frequency output Function Set up pulse and frequency output Pulse and frequency output Basis Duty cycle: 50% (Pulse frequency ≥5Hz) Frequency Setting 0.001L ~ 1 m³ Max Fmax ≤ 5000 cp/s Setting 0.5000H ~ 1 m³ Passive Uesternal ≤ 36VDC Active Setting 0.5000H ~ 2 Setting 0.5000H ~ 2 Passive Uesternal ≤ 36VDC	Power supply					
Insulation resistance ≥ 20MΩ Output Current output Function Measurement of volume or mass flow (if the density is constant) Scope 4-20 mA Setting Max 20 mA Min 4 mA Internal voltage 24 VDC Load 4 750Ω Pulse and frequency output Function Set up pulse and frequency output Function Set up pulse interquency output Final set in pulse frequency output Final set in pulse frequenc	Power supply	85-245 VAC, 5	50/60 Hz, 22-26 VDC			
Signal cable Apply only for remote type Output Current output Function Measurement of volume or mass flow (if the density is constant) Setting Scope 4-20 mA Alian Max 20 mA Min 4 mA Internal voltage 24 VDC Load ≤750Ω Pulse and frequency output Set up pulse and frequency output Function Set up pulse and frequency output Basis Duty cycle: 50% (Pulse frequency ≥5Hz) Fmax ≤ 5000 cp/s Fmax ≤ 5000 cp/s Settings 0.5001 t ~ 1 m³ Frequency Settings 0.5000 t ~ 2 Passive Uesternal ≤ 36VDC Active 1 ≤ 4.52mA Status switch output Function Can be used as alarm status output Passive Uouter ≤ 36VDC Active output voice solve output voice up ut voice solve output voice solve output current I ≤ 4.52mA Communications RS-485, HART Output Current (4-20 mA), pulse, frequency, state switch <td>Power consumption</td> <td>Max 15W</td> <td></td>	Power consumption	Max 15W				
Output Current output Function Measurement of volume or mass flow (if the density is constant) Scope 4-20 mA 4 mA 20 mA 4 mA 4 mA Internal voltage 24 VDC 24 VD	Insulation resistance	≥20MΩ				
Current output Function Measurement of volume or mass flow (if the density is constant) Scope 4-20 mA Setting Max 20 mA Internal voltage 24 VDC Load ≤750Ω Pulse and frequency output Function Set up pulse and frequency output Function Set up pulse and frequency output Output pulse width: 10-200 ms Pulse output Basis Duty cycle: 50% (Pulse frequency ≥5Hz) Finax ≤ 5000 cp/s Settings 0.0011 ~ 1 m³ Setting 0.0011 ~ 1 m³ Setting Passive Uesternal ≤ 36VDC Setting Active Uesternal ≤ 24VDC Setting Status switch output Setting 0.5000Hz Passive Uesternal ≤ 36VDC Setting Active Active output voltage U internal ≤ 24VDC Active output voltage U internal ≤ 24VDC Active output voltage U internal ≤ 24VDC Active output current I ≤ 4.52mA Communications Serial communications RS-485, HART Output Current (4-20 mA), pulse, frequenc	Signal cable	Apply only for re	emote type			
Function Measurement of volume or mass flow (if the density is constant) Scope 4-20 mA Max 20 mA Minio 4 mA Internal voltage 24 VDC Load 575Ω Pulse and frequency output Function Set up pulse and frequency output Pulse output Basis Output pulse width: 10-200 ms Duty cycle: 50% (Pulse frequency ≥5Hz) Fmax ≤ 5000 cp/s Settings 0.0011 ~ 1 m³ Settings 0.0001 ~ 2 Max Fmax ≤ 5000 Hz Settings 0.5000Hz Settings O-5000Hz Settings A62VDC Active Uputer 36VDC Active output voltage U internal ≤ 24VDC Active output current I ≤ 4.52mA Communications Rerial communications Rese	Output					
Setting Scope 4-20 mA Max 20 mA Min 4 mA Internal voltage 24 VDC Load ≤750Ω Pulse and frequency output Toutput pulse width: 10-200 ms Pulse and frequency output Output pulse width: 10-200 ms Pulse output Basis Duty cycle: 50% (Pulse frequency ≥5Hz) Fmax ≤ 5000 cp/s Settings 0.001L ~ 1 m³ Passive Destroy Active Uniternal ≤ 36VDC Active 1 ≤ 4.52mA Status switch output Function Can be used as alarm status output Passive Uouter ≤ 36VDC Active Active output voltage U internal ≤ 24VDC Active output voltage U internal ≤ 24VDC Active output current I ≤ 4.52mA Communications Serial communications RS-485, HART Output Current (4-20 mA), pulse, frequency, state switch Function Empty pipe recognition, electrode contamination Measuring accuracy ±0.5% F.S. (Flow speed > 1m/s) Measuring accuracy ±0.5% F.S. (Flow speed < 1m/s)	Current output					
Setting Max Min 20 mA Min 4 mA Internal voltage 24 VDC Load ≤750Ω Pulse and frequency output Function Set up pulse and frequency output Pulse output Output pulse width: 10-200 ms Pulse output Easis Output y cycle: 50% (Pulse frequency ≥5Hz) Fmax ≤ 5000 cp/s Settings 0.001L ~ 1 m³ Passive Max Fmax ≤ 5000Hz Setting 0-5000Hz Setting 0-5000Hz Setting 0-5000Hz Passive Ujuternal ≤ 24VDC Active Can be used as alarm status output Punction Can be used as alarm status output Passive Ujuternal ≤ 24VDC Active Active output voltage U internal ≤ 24VDC Active output current I ≤ 4.52mA Communications RS-485, HART Output Current (4-20 mA), pulse, frequency, state switch Fmax of 5000Hz Earli communications RS-485, HART Output Current	Function	Measurement of	of volume or mass flow (if the density is constant)			
Min 4 mA Internal voltage 24 VDC Load ≤750Ω Pulse and frequency output Function Function Set up pulse and frequency output Pulse output Output pulse width: 10-200 ms Basis Duty cycle: 50% (Pulse frequency ≥5Hz) Fmax ≤ 5000 cp/s Settings 0.001L ≈ 1 m³ Prequency Max Fmax ≤ 5000Hz Passive Jestings 0.5000Hz Active Uinternal ≤ 24VDC I ≤ 4.52mA Status switch output Can be used as alarm status output Passive Uouter ≤ 36VDC Active Active output voltage U internal ≤ 24VDC Active output voltage U internal ≤ 24VDC Active output current I ≤ 4.52mA Communications RS-485, HART Output Current (4-20 mA), pulse, frequency, state switch Function Empty pipe recognition, electrode contamination Measurement Accuracy Measuring accuracy ±0.5% F.S. (Flow speed > 1m/s) Measuring accuracy ±0.5% F.S. (Flow speed < 1m/s)		Scope	4-20 mA			
Internal voltage 24 VDC Load ≤750Ω Pulse and frequency output Function Set up pulse and frequency output Pulse output	Setting	Max	20 mA			
Load ≤750Ω Pulse and frequency output Function Set up pulse and frequency output Output pulse width: 10-200 ms Pulse output Duty cycle: 50% (Pulse frequency ≥5Hz) Fmax ≤ 5000 cp/s Settings 0.001L ~ 1 m³ Max Fmax ≤ 5000Hz Setting 0-5000Hz Passive Useternal ≤ 36VDC Active Active output voltage U internal ≤ 24VDC Active output voltage U internal ≤ 24VDC Active output current I ≤ 4.52mA Communications Serial communications RS-485, HART Output Current (4-20 mA), pulse, frequency, state switch Function Empty pipe recognition, electrode contamination Measuring accuracy ±0.5% F.S. (Flow speed > 1m/s) Measuring accuracy ±0.5% F.S. (Flow speed < 1m/s)		Min	4 mA			
Function Set up pulse and frequency output Function Set up pulse and frequency output Output pulse width: 10-200 ms Basis Duty cycle: 50% (Pulse frequency ≥5Hz) Fmax ≤ 5000 cp/s Settings 0.001L ~ 1 m³ Frequency Max Fmax ≤ 5000Hz Setting 0-5000Hz Passive Uexternal ≤ 36VDC Active Uinternal ≤ 24VDC I ≤ 4.52mA Status switch output Function Can be used as alarm status output Passive Uouter ≤ 36VDC Active output voltage U internal ≤ 24VDC Active output current I ≤ 4.52mA Communications Serial communications RS-485, HART Output Current (4-20 mA), pulse, frequency, state switch Function Empty pipe recognition, electrode contamination Measurement Accuracy Max measuring error Measuring accuracy ±0.5% F.S. (Flow speed > 1m/s) Measuring accuracy ±0.5% F.S. (Flow speed < 1m/s) Measuring accuracy ±0.5% F.S. (Flow speed < 1m/s)	Internal voltage	24 VDC				
Function Set up pulse and frequency output Output pulse width: 10-200 ms Duty cycle: 50% (Pulse frequency ≥5Hz) Fmax ≤ 5000 cp/s Settings 0.001L ~ 1 m³ Max Fmax ≤ 5000Hz Setting 0-5000Hz Passive Usutemal ≤ 36VDC Active 1 ≤ 4.52mA Status switch output Function Can be used as alarm status output Passive Uouter ≤ 36VDC Active output voltage U internal ≤ 24VDC Active output current I ≤ 4.52mA Communications Serial communications RS-485, HART Output Current (4-20 mA), pulse, frequency, state switch Function Empty pipe recognition, electrode contamination Measuring accuracy ±0.5% F.S. (Flow speed > 1m/s) Measuring accuracy ±0.5% F.S. (Flow speed < 1m/s) Measuring accuracy ±0.5% F.S. (Flow speed < 1m/s) Measuring accuracy ±0.5% F.S. (Flow speed < 1m/s)	Load	≤750Ω				
Pulse output Basis Duty cycle: 50% (Pulse frequency ≥5Hz) Fmax ≤ 5000 cp/s Settings 0.001L ~ 1 m³ Max Frequency Passive Duty cycle: 50% (Pulse frequency ≥5Hz) Fmax ≤ 5000 cp/s Settings 0.001L ~ 1 m³ Max Fmax ≤ 5000Hz Passive Uexternal ≤ 36VDC Unternal ≤ 24VDC I ≤ 4.52mA Status switch output Function Can be used as alarm status output Passive Uouter ≤ 36VDC Active output voltage U internal ≤ 24VDC Active output current I ≤ 4.52mA Communications Serial communications RS-485, HART Output Current (4-20 mA), pulse, frequency, state switch Function Empty pipe recognition, electrode contamination Measurement Accuracy Max measuring error Measuring accuracy ±0.5% F.S. (Flow speed > 1m/s) Measuring accuracy ±0.5% F.S. ±2mm/s (Flow speed < 1m/s)	Pulse and frequency output					
Pulse output Basis Duty cycle: 50% (Pulse frequency ≥5Hz) Fmax ≤ 5000 cp/s Settings 0.001L ~ 1 m³ Max Fmax ≤ 5000Hz Setting 0-5000Hz Passive U _{External} ≤ 36VDC Active U _{Internal} ≤ 24VDC 1 ≤ 4.52mA Status switch output Function Can be used as alarm status output Passive U _{Outer} ≤ 36VDC Active output voltage U internal ≤ 24VDC Active output current I ≤ 4.52mA Communications Serial communications RS-485, HART Output Current (4-20 mA), pulse, frequency, state switch Function Empty pipe recognition, electrode contamination Measurement Accuracy Max measuring error Measuring accuracy ±0.5% F.S. (Flow speed < 1m/s) Measuring accuracy ±0.5% F.S. ±2mm/s (Flow speed < 1m/s)	Function	Set up pulse an	nd frequency output			
Frequency Setting 0-5000Hz Passive $U_{External} \leq 36VDC$ Active $U_{Internal} \leq 24VDC$ $I \leq 4.52mA$ Status switch output Function Can be used as alarm status output Passive $U_{Outer} \leq 36VDC$ Active output voltage U internal $\leq 24VDC$ Active output current $I \leq 4.52mA$ Communications Serial communications RS-485, HART Output Current (4-20 mA), pulse, frequency, state switch Function Empty pipe recognition, electrode contamination Measurement Accuracy Max measuring error Measuring accuracy $\pm 0.5\%$ F.S. (Flow speed $> 1m/s$) Measuring accuracy $\pm 0.5\%$ F.S. $\pm 2mm/s$ (Flow speed $\leq 1m/s$)	Pulse output		Duty cycle: 50% (Pulse frequency ≥5Hz) Fmax ≤ 5000 cp/s			
Passive $U_{External} \le 36 \text{VDC}$ Active $U_{internal} \le 24 \text{VDC}$ $I \le 4.52 \text{mA}$ Status switch output Function Can be used as alarm status output Passive $U_{outer} \le 36 \text{VDC}$ Active output voltage U internal $\le 24 \text{VDC}$ Active output current $I \le 4.52 \text{mA}$ Communications Serial communications RS-485, HART Output Current (4-20 mA), pulse, frequency, state switch Function Empty pipe recognition, electrode contamination Measurement Accuracy Max measuring error Measuring accuracy $\pm 0.5\%$ F.S. (Flow speed $> 1 \text{m/s}$) Measuring accuracy $\pm 0.5\%$ F.S. $\pm 20 \text{m/s}$ (Flow speed $\pm 0.5\%$ F.S. $\pm 20 \text{m/s}$)	Frequency					
Active $\begin{array}{lll} U_{internal} \leqslant 24 \text{VDC} \\ I \leqslant 4.52 \text{mA} \end{array}$ Status switch output $\begin{array}{lll} Function & Can be used as alarm status output \\ Passive & U_{Outer} \leqslant 36 \text{VDC} \\ Active & Active output voltage U internal \leqslant 24 \text{VDC} \\ Active output current I \leqslant 4.52 \text{mA} \end{array}$ $\begin{array}{lll} Communications & RS-485, HART \\ Output & Current (4-20 mA), pulse, frequency, state switch \\ Function & Empty pipe recognition, electrode contamination \\ Measurement Accuracy & Measuring accuracy \pm 0.5\% F.S. (Flow speed > 1 m/s) Measuring accuracy \pm 0.5\% F.S. \pm 2 mm/s (Flow speed < 1 m/s)$	Passivo					
$\begin{tabular}{lllllllllllllllllllllllllllllllllll$		U _{internal} ≤ 24V[
$\begin{tabular}{lllllllllllllllllllllllllllllllllll$	Status switch output					
$\begin{tabular}{lllllllllllllllllllllllllllllllllll$	·	Can be used as	s alarm status output			
Active output current I ≤ 4.52mA Communications Serial communications RS-485, HART Output Current (4-20 mA), pulse, frequency, state switch Function Empty pipe recognition, electrode contamination Measurement Accuracy Max measuring error Measuring accuracy ±0.5% F.S. (Flow speed > 1m/s) Measuring accuracy ±0.5% F.S.±2mm/s (Flow speed <1m/s)	Passive		·			
Active output current I ≤ 4.52mA Communications Serial communications RS-485, HART Output Current (4-20 mA), pulse, frequency, state switch Function Empty pipe recognition, electrode contamination Measurement Accuracy Max measuring error Measuring accuracy ±0.5% F.S. (Flow speed > 1m/s) Measuring accuracy ±0.5% F.S.±2mm/s (Flow speed <1m/s)		Active output vo	oltage U internal ≤ 24VDC			
Serial communications RS-485, HART Output Current (4-20 mA), pulse, frequency, state switch Function Empty pipe recognition, electrode contamination Measurement Accuracy Measuring accuracy ±0.5% F.S. (Flow speed > 1m/s) Measuring accuracy ±0.5% F.S.±2mm/s (Flow speed <1m/s)	Active					
Output Current (4-20 mA), pulse, frequency, state switch Function Empty pipe recognition, electrode contamination Measurement Accuracy Measuring accuracy ±0.5% F.S. (Flow speed > 1m/s) Measuring accuracy ±0.5% F.S.±2mm/s (Flow speed <1m/s)	Communications					
Function Empty pipe recognition, electrode contamination Measurement Accuracy Measuring accuracy ±0.5% F.S. (Flow speed > 1m/s) Measuring accuracy ±0.5% F.S.±2mm/s (Flow speed <1m/s)	Serial communications	RS-485, HART				
Measurement Accuracy Max measuring error Measuring accuracy ±0.5% F.S. (Flow speed > 1m/s) Measuring accuracy ±0.5% F.S.±2mm/s (Flow speed <1m/s)	Output	Current (4-20 mA), pulse, frequency, state switch				
Measuring accuracy ±0.5% F.S. (Flow speed > 1m/s) Measuring accuracy ±0.5% F.S.±2mm/s (Flow speed <1m/s)	Function	Empty pipe recognition, electrode contamination				
Measuring accuracy ±0.5% F.S.±2mm/s (Flow speed <1m/s)	Measurement Accuracy					
Repetitiveness 0.16%	Max measuring error		·			
	Repetitiveness	0.16%				

Operating Environment						
Operating Environment	40 FF20 (O) 4 T F1					
	-10 - 55°C for Compact Type Flowmeter					
Environment temperature	-10 - 60°C for Sensor of Remote Type Flowmeter					
Chamana taman anatura	-10 - 55°C for Converter of Remote Type Flowmeter					
Storage temperature	-40 - 65°C					
Electric Conductivity	Min. 20 v.C/are					
Water	Min. 20 μS/cm					
water	(The best measurement results can be achieved, when electric conductivity is greater than 30 μS/cm)					
	Min. 5 µS/cm					
Other medium	(The best measurement results can be achieved, when electric conductivity is					
Other medium	greater than 30 µS/cm)					
Materials	G					
Sensor housing	Carbon steel, stainless steel 304, stainless steel 316L					
Converter	Standard painted die cast aluminum					
Cable gland material	M20*1,5. Polyamide.					
Cable material	Polyurethane					
Display User Interface						
Graphic display	Monochrome LCD, white backlight; Size: 128*64 pixels					
Display function	2 measurement value pictures (measurements, condition, etc)					
Language	Chinese/ English/Spanish					
Unit	Units can be selected via the configuration menu					
Menu navigation	4 mechanical buttons (Compact Type) or 4 touch buttons (Remote Type)					
Measuring System						
Measuring principle	Faraday's law of electromagnetic induction					
Function	Instant flow rate, flow velocity, mass flow rate (if the density is constant),					
FullClion	flow totalizer function.					
Module configuration	Measurement system consists of signal converter and measuring					
Wodule Comiguration	sensor					
Converter						
Compact Type	IP65					
Remote Type	IP65 for transmitter (IP65/IP68 for sensor)					
Measurement sensor						
Nominal Diameter	DN15-DN1200					
	In line with GB/T9119-2000, JB/81-2015 standards carbon steel					
Flange	(Optional stainless steel flanges), other standard flange can be					
	customized (according to DIN:EN 1092-1, ASME: ANSI150 etc.)					
	DN15 - DN250, PN ≤1.6MPa					
Pressure rating	DN300 - DN1000, PN ≤1.0MPa					
	DN1200, PN ≤0.6MPa					
	Higher pressure can be customized					

Lining Material	Neoprene (CR), Polyurethane (PU), PTFE (F4), PFEP (F46), PFA					
Electrode Material	316L Stainless Steel, Hastelloy C, Hastelloy B, Ti, Ta, Pt					
Parameter	Remote type	Compact type				
Ingress protection	IP65 for converter, IP68 for sensor	IP65				
	Neoprene: -10+60°C	Neoprene: -10+60°C				
Madium tamparatura	Polyurethane: -10+60°C	Polyurethane: -10+60°C				
Medium temperature	PTFE/FEP: -10+120°C	PTFE/FEP: -10+120°C				
	PFA: -10+180°C	PFA: -10+120°C				
Buried depth	Not deeper than 5 meters (only for remote type sensors with IP68 protection)					
Immersion depth	Not deeper than 3 meters (only for remote type sensors with IP68 protection)					
Sensor cable	Suitable only for remote type instruments. The standard cable length 10 m; flowmeters can be equipped with a cable of optional length up 100 m.					


Electrode selection	
Material	Corrosion Resistance
Molybdenum-containing stainless steel	<u>Applicable:</u> domestic water, industrial water, sewage, weak acid-base salt solutions, normal temperature concentrated nitric acid
(0Cr18N12Mo2Ti)	Not applicable: hydrofluoric acid, hydrochloric acid, chlorine, bromine, iodine and other media.
Hastelloy B	Applicable: non-oxidizing acids, such as hydrochloric acid and hydrofluoric acid of certain concentration, alkaline solutions with a concentration of no less than 70% sodium hydroxide.
	Not applicable: nitric acid and other oxidizing acids.
Hastelloy C	Applicable: oxidizing acids, such as nitric acid, mixed acid, or sulfuric acid mixed corrosive media, corrosive environments with oxidizing salts or other oxidizing agents such as hypochlorite solution above room temperature, seawater.
	Not applicable: reducing acids such as hydrochloric acid and chlorides.
T	Applicable: chloride, hypochlorite, seawater, oxidizing acid.
Ti	Not applicable: reducing acids such as hydrochloric acid, sulfuric acid, etc.
Та	<u>Applicable:</u> most acids, such as concentrated hydrochloric acid, nitric acid and sulfuric acid, including hydrochloric acid with boiling point, nitric acid and sulfuric acid below $175^{\circ}C$.
	Not applicable: alkalis, hydrofluoric acid, sulfur trioxide.
Pt	Applicable: various acids (excluding aqua regia), alkalis and salts.

Notes: Due to the wide variety of media, and its corrosiveness is affected by temperature, concentration, flow rate and other complex factors and changes, so this table is only for reference, the user should make their own choice according to the actual situation. For general media, you can consult the relevant anti-corrosion manual. For mixed acid and other components of complex media, the proposed material should be done to choose the corrosion test


Lining Sele	ction				
Lining material	Symbol	Properties	Max. operating temperature	Applicable medium	Nominal diameter
Neoprene	CR	Average abrasiveness, good for acids, alkalis, and salts solutions.	<60°C	Domestic water, sea water, industrial water	≥DN50
Polyurethane	PU	Has very good antiabrasive quality; not good for acids, alkali solutions	<60°C	Slurry such as mine slurry, pulp and paper	≪DN600


PTFE	F4	Stable chemical property, proof against the corrosion of boiling hydrochloric acid, sulphuric acid, nitric acid and aqua regia, concentrated alkalis	<120°C	Strong corrosive acids, alkali solution	DN15-1200
FEP	F46	Same chemical properties as F4, but with better tensile strength and pressure resistance.	<120°C	Corrosive acids, alkali, and salts solutions	DN15-1200
PFA	PFA	Same chemical properties as F46, but with better tensile strength and pressure resistance.	<120°C (Compact) <180°C (Remote)	Corrosive acids, alkali, and salts solutions	≪DN500

Dimension and Pressure

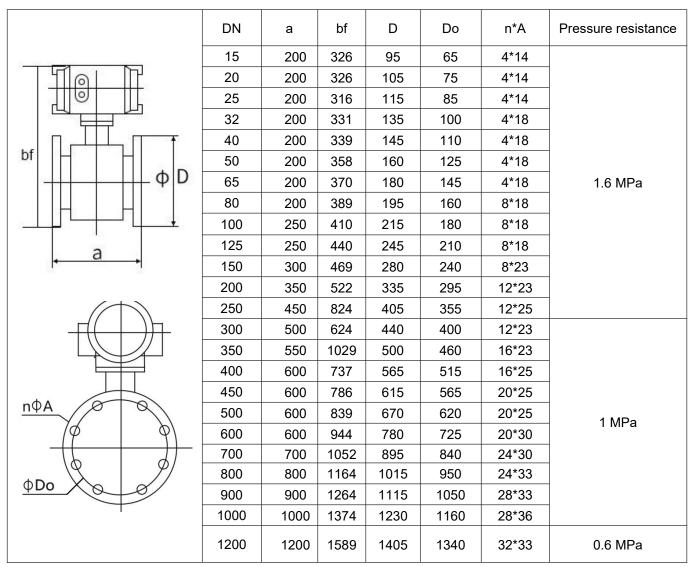

Unit:mm

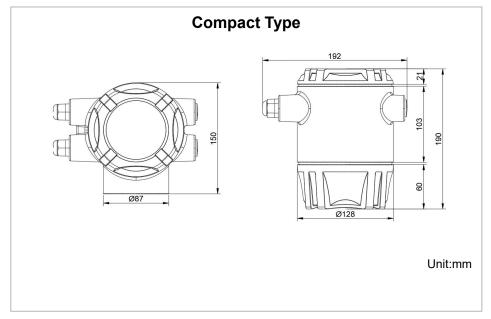

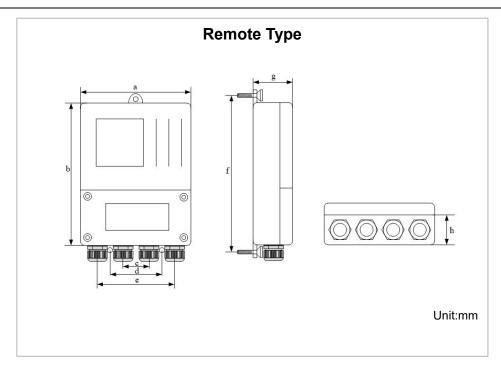

Dimensio	Weight[kg]							
а	a b c d e f g h							
164	214.5	34	70	102	233.5	69.7	45.7	0.6

Flow Range

Nominal Diameter		Flow range (m³/h)	
(mm)	The optional lower range value can be selected from the following array	Standard	The optional upper range value can be selected from the following array
15	0.0636-0.6	0.8-3.0	4.0-7.632
20	0.131-1.0	1.2-5.0	6.0-13.6
25	0.176-1.6	2.0-8.0	10-21
32	0.2895-2.5	3.0-12	16-35
40	0.4524-4.0	5.0-20	25-45
50	0.707-6.0	8.0-40	50-85
65	1.195-10	12-60	80-143
80	1.81-16	20-120	160-217
100	2.83-25	30-160	200-339
125	4.42-40	50-250	300-530
150	6.36-60	80-400	500-763
200	11.3-100	120-600	800-1357
250	17.7-160	200-800	1000-2120
300	25.45-250	300-1200	1600-3054
350	34.6-300	400-1600	2000-4157
400	45.2-400	500-2000	2500-5429
450	57.3-500	600-2500	3000-6871
500	70.7-600	800-3000	4000-8482
600	102-800	1000-4000	5000-12216
700	139-1200	1600-5000	6000-16620
800	181-1600	2000-6000	8000-21720
900	229-1600 2000-8000		10000-27480
1000	283-2000	2500-10000	12000-33924
1200	407-2500	3000-12000	16000-48833

Reduction formula: (Flow)Q = (flow velocity) $V \times \pi \times (DN/2)^2$, Units: m/s and m³/h

Flow and Velocity

Flo w DN(mm)	0.5	5
DN15	0.32	3.2
DN20	0.56	5.6
DN25	0.88	8.8
DN32	1.4	14
DN40	2.3	23
DN50	3.5	35
DN65	6	60
DN80	9	90
DN100	14	140
DN125	22	220
DN150	32	320
DN200	56	560
DN250	88	880
DN300	127	1270
DN350	173	1730
DN400	226	2260
DN450	286	2860
DN500	353	3530
DN600	509	5090
DN700	693	6930
DN800	905	9050
DN900	1150	11500
DN1000	1410	14100
DN1200	2040	20400

★ Process connection

Note: Flanges can be customized, and the pressure need to be considerate



Clamp on (Stainless steel)


Flange (Stainless steel)

Flange (Carbon steel)

DN15 - DN250, PN \leq 1.6MPa DN300 - DN1000, PN \leq 1MPa DN1200, PN \leq 0.6MPa

★ Location


Do not install the electromagnetic flowmeter on a free-vibrating pipe without any support. Instead, a mounting base shall be used to secure the measuring tube. When the electromagnetic flowmeter is required to be installed underground, the pipes at both inlet and outlet ends shall be provided with support items, and a metal protection plate shall be installed above the flowmeter.

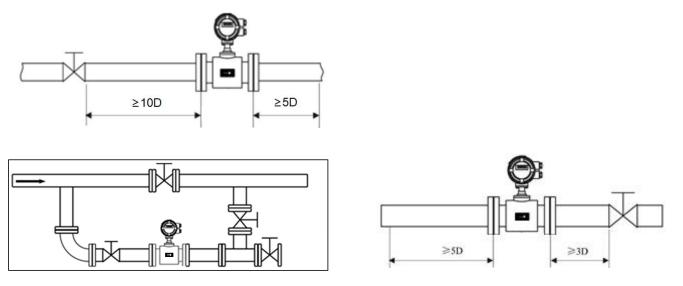

(1) No bubbles shall be observed in the pipes.


Pipes shall be designed to prevent the air bubbles in the fluids from accumulating the measurement pipe of a sensor. If a valve exists near the flowmeter, try to mount the flowmeter on the valve's upstream side for preventing a decrease of pressure inside the pipe possibly, consequently avoiding the possibility of air bubbles.

ensure that no gas can be separated from the liquid.

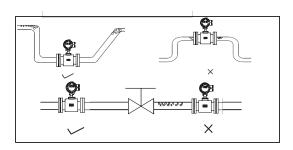

(2) Flow direction


The flowmeter can be set to automatically detect the positive and negative flow direction. The flow direction arrow on the sensor casing indicates the positive flow direction specified by the manufacturer. Generally, when installing the meter, the user shall make the flow arrow consistent with the on-site process flow.

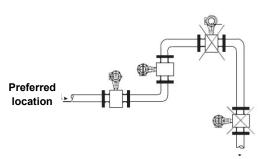

The pipe is routed to the highest point (Bubble accumulation in the measuring tube is likely to cause produce measurement errors!)


Make sure the pipeline is always full.

(3) The electromagnetic flowmeter cannot be installed on




the suction side of the pump


(4) For long pipelines, control valves are generally installed on the downstream of the electromagnetic flowmeter.



(5) For pipes with open discharges, the electromagnetic flowmeter shall be installed at the bottom section (lower part of the pipe).



(6) For places where fall head of pipes is over 5 m, the air valve shall be installed on the downstream of the electromagnetic flowmeter



(8) Measurement error caused by incidental gas and damage of lining caused by vacuum shall be avoided


(9) Grounding

As the voltage of induced signal of electromagnetic flowmeter is small, it's more prone to be affected by noises or other electromagnetic signals. This is why the electromagnetic flowmeter needs to be grounded in many occasions. This functions to form an internal space for shielding external interference through the grounding of flowmeter casing, thereby improving measurement accuracy.

Wiring


Remote

L, N:	100-240VAC power supply 24VDC power supply
ALM1, ALM2	Relay out
POUT, PCOM	Pulse/Frequency output
485A, 485B:	RS-485 communication
IOUT, ICOM:	4-20mA output
EXT1, EXT2	Excitation signal
SIG1, SIG2, SGND	Electrode signal
DS1, DS2	Electrode shield

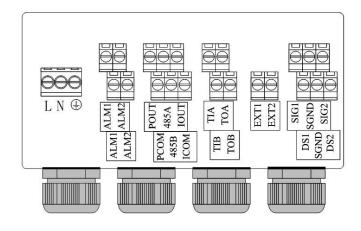

Compact type

L, N:	100-240VAC power supply 24VDC power supply
485A, 485B:	RS-485 communication
IOUT, ICOM:	4-20mA output connection
POUT, PCOM:	Pulse/Frequency
CCOM:	RS-485 communication ground
	Protective earth

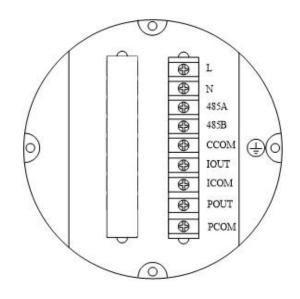

Ordering Code

LDG-SIN-10)-J-A	-MC-	·K-A/	4-M3	-N6-	WA-0	00-1			
LDG-SIN	Γ.	_	_	_	_	_	_	_	_	 Description
	10									DN10(3/8")
	15									DN15(1/2")
	20									DN20(3/4")
	25									DN25 (1 ")
	32									DN32(1.25")
	40									DN40(1.5")
	50									DN50 (2 ")
	65									DN65(2.5")
	80									DN80 (3 ")
	1C									DN100 (4 ")
	1E									DN125 (5 ")
Nominal	1G									DN150 (6 ")
Diameter	2C									DN200 (8 ")
	2G									DN250 (10 ")
	3C									DN300 (12 ")
	3G									DN350 (14 ")
	4C									DN400 (16 ")
	4G									DN450 (18 ")
	5C									DN500 (20 ")
	6C									DN600 (24 ")
	7C									DN700 (28 ")
	8C									DN800 (32 ")
	9C									DN900 (36 ")
	A0									DN1000 (40 ")
		J								JB/T 81 Flange
Throad Tu		D								GB/T9124 Flange
Thread Typ Standard		G								Clamp
Staridard	1	-1								ISO2852 Clamp
		Χ								Others
			Α							PN6
			В							PN10
			С							PN16
Nominal Pr	ressu	re	D							PN25
			Ε							PN40
			F							PN63
			Χ							Other

MC							Carbon steel CS
Process Connection M1							304SS
Material and Body Material XX							Others
Accuracy K							Grade 0.5
, testinasy	AA						4-20mA + Pulse + RS485, 220VAC
Output and Power Supply	AB						4-20mA + HART + pulse, 220VAC
	AM						4-20mA + Pulse + RS485, 24VDC
	AK						4-20mA + HART + pulse, 24VDC
	,	M3					316LSS
		MF					Hastelloy B
Electrode Material		MG					Hastelloy C
		T1					Ti
		T2					Ta
		МН					Platinum-iridium alloy
		MJ					WC
			N6				PTFE
			N1				CR
Lining Material			N2				PU
			N7				FEP (F46)
Electrical Interface, Shell Material and Protection Level				10/0			Integrated version, M20 × 1. 5
			ion	WA			cable gland, aluminum alloy, IP65
				WC			Remote version, M20 × 1. 5 cable
				VVC			gland, aluminum alloy, IP68
Split Cable Length					00		0m
					10		10m
					15		15m
				20		20m	
					25		25m
					30		30m
					40		40m
					50		50m
					XX		Others
Language						1	CHINA
					2	ENGLISH	
					3	Russian	
					4	Spanish (Brazil)	
					5	Portuguese (Brazil)	
						Χ	Others